

Deadweight tester selection guide



The deadweight tester (DWT) is a very robust and flexible pressure measurement standard. This guide is intended to simplify the process of selecting the right deadweight tester for your application. The following considerations will help you get started:

- Pressure range
- Pressure media
- Pressure generation options
- Weight increments
- Accuracy
- Adapters
- Available models



Bestselling pneumatic deadweight testers*

P3025	3.5 MPa (500 psi)
P3015	3.5 MPa (500 psi)
P3031	7 MPa (1000 psi)
P3011	100 kPa (30 mmHg)
P3022	100 kPa (400 inH2O)
P3014	1 MPa (150 psi)
P3023	200 kPa (800 inH2O)
P3012	100 kPa (400 inH2O)

*For details about these and other models, see the table starting on page 4.



Bestselling hydraulic deadweight testers*

P3123	35 MPa (5000 psi)
P3125	110 MPa (16000 psi)
P3223	35 MPa (5000 psi)
P3224	70 MPa (10000 psi)
P3124	70 MPa (10000 psi)
P3116	140 MPa (20000 psi)
P3114	70 MPa (10000 psi)
P3112	14 MPa (2000 psi)
P3113	35 MPa (5000 psi)
P3213	35 MPa (5000 psi)

*For details about these and other models, see the tables starting on page 6.

Things to consider when selecting a deadweight tester

Range

The first thing to consider is the pressure range. One of the advantages of a DWT is the wide range of instruments that it can cover. The DWT is an inherent percent-of-reading device, meaning that its performance actually improves as it is used at pressures below full scale. There is a lower breakpoint, normally 10% of full scale, where the specification ceases to be percent of reading.

When selecting the range of a deadweight tester, first consider the highest pressure that needs to be generated. The full scale needs to be greater than this. Since the accuracy is a percent of reading specification, it is okay to consider possible future expansion and select a DWT that has a higher full scale than what is currently needed.

The next step is to confirm that the unit can generate the lowest pressure that is required. As stated, the performance is less than ideal when the pressure being generated is below 10% of the full scale. Applications that require both low and high hydraulic pressures can be handled using dual piston units. These units are provided with both a low range and high range piston/cylinder. Switching between the low range and high range on a Fluke Calibration DWT is as simple as removing the masses from one piston and placing them on the other. No valves need to be switched.

Many pneumatic devices also support measuring gauge mode pressures that are below atmospheric pressure. This is often referred to as negative gauge or vacuum mode. To support the calibration of these devices, a DWT can be provided with a vacuum piston, where the piston is

suspended with the weights below it. A partial vacuum is then generated above the piston to float the piston. The Fluke Calibration P3000 is available in configurations of vacuum only, positive pressure only, or combined vacuum and pressure. Due to the relatively low additional cost of having a combined pressure/vacuum system, they are normally preferable.

Media

The next thing to consider when selecting a DWT is the medium to be used. Often the choice of the medium is dependent upon the pressure range required. Pneumatic, or gas, instruments are ideal for lower pressure ranges. Gas is preferred whenever cleanliness is required. In addition, using gas reduces the impact of head height corrections. However, at higher pressures it is necessary to use water or oil.

The usefulness of gas as a medium is limited to approximately 2000 psi. There are two reasons for this. First, there is more risk of explosion at high gas pressures, and that is a safety concern. Second, generating high gas pressure will require expensive intensifiers or gas boosters. Using oil or water eliminates these issues. Since water is not a very good lubricant, oil is preferable when allowed.

One advantage of liquids is they are incompressible. This allows a small change in the volume of the system (through a screw pump) to result in large changes in pressure. The most common approach is to use a mineral oil as the medium. This is ideal in that it assists in lubricating the piston and cylinder. The downside to using oil as a medium is it now introduces the device under test to possible contamination.

If a device under test cannot be exposed to oil, then there are a couple of options available. First, in certain devices you can use water instead. Another option is to use a liquid-to-liquid separator. The separator allows you to use one liquid in the device under test and another in the DWT. Second, certain ranges are available with water as the media. This allows for the device under test to be connected straight to the deadweight tester without oil contamination.

Pressure generation

A DWT is a complete solution that encompasses both the ability to measure the pressure as well as generate the pressure.

To increase pressure in a hydraulic deadweight tester, a priming pump is used. Fluke Calibration P3100 and P3200 Series Deadweight Testers have a priming pump included standard in the device. The priming pump can also be used to remove gas from the system.

For low gas pressures, the pressure is generated using a hand pump. Higher gas pressures (more than 2 MPa or 300 psi) require the use of an external source, such as a nitrogen bottle. Even when pumps are rated to higher pressures, users will normally find them difficult to use because of the forces involved.

Generation of negative gauge, or vacuum, is similar in concept to positive pressure. For lower vacuum pressures with small volumes a built in hand pump will be sufficient. For larger volumes or higher vacuums, an external vacuum pump may be desirable.

Weight sets


Deadweight testers use a precision piston-gauge system consisting of a vertically mounted, piston and cylinder assembly, and accurately calibrated weight masses that are loaded onto the piston. Weight sets are available in a variety of units of measure such as psi, inH₂O or MPa, and are calibrated to match a specific deadweight tester. If more than one unit of measure is desired then, additional weight sets called conversion weight sets, can be purchased in the desired units and calibrated to match the same deadweight tester.

On certain deadweight testers, a fine increment weight set is also available. This is useful when calibrating a wide range of devices by allowing for more discrete pressure set points. These smaller weights supplement the larger weights to produce fine incremental pressures. For more information on the standard weight sets provided as well as the fine increment weight sets, please see document 4090591, "Pressure Measurements Deadweight Tester's Weight Increments."

Accuracy

Like most measurement systems there are many factors that affect your accuracy. Potentially, the largest factor affecting accuracy in a deadweight tester is local gravity. Gravity varies slightly from one location to another (see map). This has an impact on the nominal pressure increments of a deadweight tester. To overcome this issue, at

the time of manufacture Fluke Calibration trims the weights to produce the correct nominal pressures at your location. This is

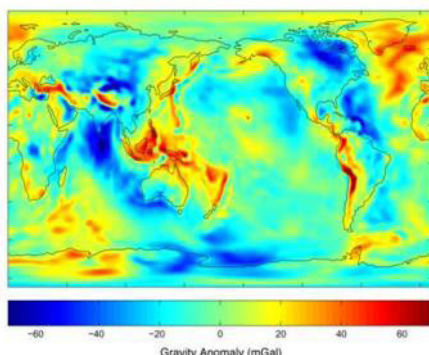

an advantage of buying a new deadweight tester and having the manufacturer trim the weights for you.

Deadweight testers are available in the marketplace at varying accuracy classes. When comparing accuracy specifications it is important to realize that those values can only be realized under the right conditions. Better accuracies may require the users to make additional corrections not mentioned on the data sheet. For example, an accuracy of 0.006 % may only be valid if you correct for temperature and use a more accurate value for local gravity in your calculations.

Each Fluke Calibration DWT is available with standard accuracy or an improved accuracy option. Instruments with the improved accuracy option come standard with software to assist in the calculation of the generated pressure.

For better accuracies, a piston gauge may be appropriate. A piston gauge works on the same principle as a DWT but is designed, built, and operated in such a way to provide improved uncertainties.

Adapters

A DWT will include a test port to allow for the connection of the unit under test. Since one of the inherent features of a DWT is its flexibility, it is important that the test port connection be adaptable to multiple types of pressure devices.

The test port on a Fluke Calibration DWT is available with adaptors for various sizes and types, 1/8, 1/4, 3/8, and 1/2 NPT and BSP as well as M20 x 1.5 and M14 x 15 included standard. Due to the unique design of the Fluke Calibration test port, all of the above adapters are capable of providing leak tight seals to 140 MPa (20,000 psi) without the use of wrenches or PTFE tape.

Calibration

The measurements that you make with your deadweight tester are very important, and often influence decisions that have a big financial impact on your company. It is important to ensure that you have the highest quality calibration data backing up the measurements that you make. Fluke Calibration automatically provides an ISO 17025 accredited calibration for each DWT. With an ISO 17025 accredited calibration, you know that the calibration laboratory has been assessed by third party calibration experts to ensure that the technician training, environment, procedures, measurement uncertainty, equipment used and measurement traceability associated with the calibration all are performed to stringent requirements. Having your DWT accompanied with an ISO 17025 accredited calibration also reduces total cost to your company by reducing, or in some cases eliminating, the need for supplier audits, with a potential savings of hundreds or even thousands of dollars.

Some customers may require you to demonstrate that the calibration of your DWT is traceable to the International System of Units (SI), usually through a national metrology institute like NIST. When your DWT comes with an accredited calibration, this has been internationally recognized to provide sufficient demonstration of traceability. You won't have to spend the additional time calling your calibration supplier and requesting additional documentation in order to prove that your measurements are traceable.

When your work is important, and your measurements matter, an accredited calibration is a great way to provide additional confidence in your measurement results and to demonstrate to your customers that you meet their quality requirements.

P3000 gas operated (pneumatic) deadweight testers

Proven, reliable, and clean pressure calibration from vacuum to 2,000 psi.

- 0.015 % accuracy standard, 0.008 % optional
- Piston-cylinder design provides stability and repeatability
- High quality needle valves provide optimum control
- Test station design provides quick connection without the need for PTFE tape or wrenches



Each unit includes

- Weight Set trimmed to supplied local gravity
- Detachable lid
- High quality case
- Accredited calibration certificate
- Operating fluid (where applicable)
- Spare seals
- Adaptors for 1/8, 1/4, 3/8, 1/2 NPT and BSP and metric adaptors (M20 and M14)

Pressures up to 2000 psi

Unit	Model	Internal pump	Pressure range				Vacuum range	
			Minimum	Maximum	Standard Increment	Optional Increment	Maximum	Increment
SI	P3031-KPA	N/A	100 kPa	7000 kPa	10 kPa	N/A	N/A	N/A
	P3031-MPA	N/A	0.1 MPa	7 MPa	0.01 MPa	N/A	N/A	N/A
	P3032-KPA	N/A	100 kPa	14000 kPa	10 kPa	N/A	N/A	N/A
	P3032-MPA	N/A	0.1 MPa	14 MPa	0.01 MPa	N/A	N/A	N/A
bar	P3031-BAR	N/A	1 bar	70 bar	0.1 bar	N/A	N/A	N/A
	P3032-BAR	N/A	1 bar	140 bar	0.1 bar	N/A	N/A	N/A
psi	P3031-PSI	N/A	10 psi	1000 psi	1 psi	N/A	N/A	N/A
	P3032-PSI	N/A	10 psi	2000 psi	1 psi	N/A	N/A	N/A
kgf/cm ²	P3031-KGCM2	N/A	1 kgf/cm ²	70 kgf/cm ²	0.1 kgf/cm ²	N/A	N/A	N/A
	P3032-KGCM2	N/A	1 kgf/cm ²	140 kgf/cm ²	0.1 kgf/cm ²	N/A	N/A	N/A



From vacuum to 500 psi

Unit	Model	Internal pump	Pressure range				Vacuum range	
			Minimum	Maximum	Standard Increment	Optional Increment	Maximum	Increment
SI	P3022-KPA	Optional	1.5 kPa	100 kPa	0.5 kPa	N/A	100 kPa	1 kPa
	P3023-KPA	Optional	3 kPa	200 kPa	1 kPa	N/A	100 kPa	1 kPa
	P3025-KPA	Optional	20 kPa	3500 kPa	10 kPa	1 kPa	100 kPa	1 kPa
	P3025-MPA	Optional	0.02 MPa	3.5 MPa	0.01 MPa	0.001 MPa	100 kPa	1 kPa
bar	P3022-MBAR	Optional	15 mbar	1000 mbar	5 mbar	N/A	1000 mbar	10 mbar
	P3023-MBAR	Optional	30 mbar	2000 mbar	10 mbar	N/A	1000 mbar	10 mbar
	P3025-BAR	Optional	0.2 bar	35 bar	0.1 bar	0.01 bar	1000 mbar	10 mbar
psi	P3022-INH2O	Optional	5 inH ₂ O	400 inH ₂ O	1 inH ₂ O	N/A	30 inHg	0.2 inHg
	P3023-INH2O	Optional	12 inH ₂ O	800 inH ₂ O	2 inH ₂ O	N/A	30 inHg	0.2 inHg
	P3025-PSI	Optional	3 psi	500 psi	1 psi	0.1 psi	30 inHg	0.2 inHg
kgf/cm ²	P3031-KGCM2	Optional	0.2 kgf/cm ²	35 kgf/cm ²	0.1 kgf/cm ²	0.01 kgf/cm ²	760 mmHg	10 mmHg


Pressures up to 500 psi

Unit	Model	Internal pump	Pressure range				Vacuum range	
			Minimum	Maximum	Standard increment	Optional increment	Maximum	Increment
SI	P3012-KPA-P	Standard	1.5 kPa	100 kPa	0.5 kPa	N/A	N/A	N/A
	P3013-KPA-P	Standard	3 kPa	200 kPa	1 kPa	N/A	N/A	N/A
	P3014-KPA-P	Standard	20 kPa	1000 kPa	10 kPa	1 kPa	N/A	N/A
	P3014-MPA-P	Standard	0.02 MPa	1 MPa	0.01 MPa	0.001 MPa	N/A	N/A
	P3015-KPA	Optional	20 kPa	3500 kPa	10 kPa	1 kPa	N/A	N/A
	P3015-MPA	Optional	0.02 MPa	3.5 MPa	0.01 MPa	0.001 MPa	N/A	N/A
bar	P3012-MBAR-P	Standard	15 mbar	1000 mbar	5 mbar	N/A	N/A	N/A
	P3013-MBAR-P	Standard	30 mbar	2000 mbar	10 mbar	N/A	N/A	N/A
	P3014-BAR-P	Standard	0.2 bar	10 bar	0.1 bar	0.01 bar	N/A	N/A
	P3015-BAR	Optional	0.2 bar	35 bar	0.1 bar	0.01 bar	N/A	N/A
psi	P3012-INH2O-P	Standard	5 inH ₂ O	400 inH ₂ O	1 inH ₂ O	N/A	N/A	N/A
	P3013-INH2O-P	Standard	12 inH ₂ O	800 inH ₂ O	2 inH ₂ O	N/A	N/A	N/A
	P3014-PSI-P	Standard	3 psi	150 psi	1 psi	0.1 psi	N/A	N/A
	P3015-PSI	Optional	3 psi	500 psi	1 psi	0.1 psi	N/A	N/A
kgf/cm ²	P3014-KGCM2-P	Standard	0.2	10 kgf/cm ²	0.1 kgf/cm ²	0.01 kgf/cm ²	N/A	N/A
	P3015-KGCM2	Optional	0.2	35 kgf/cm ²	0.1 kgf/cm ²	0.01 kgf/cm ²	N/A	N/A


Vacuum only

Unit	Model	Internal pump	Pressure range				Vacuum range	
			Minimum	Maximum	Standard increment	Optional increment	Maximum	Increment
SI	P3011-KPA	Optional	N/A	N/A	N/A	N/A	100 kPa	1 kPa
bar	P3011-MBAR	Optional	N/A	N/A	N/A	N/A	1000 mbar	10 mbar
psi	P3011-INHG	Optional	N/A	N/A	N/A	N/A	30 inHg	0.2 inHg
kgf/cm ²	P3011-MMHG	Optional	N/A	N/A	N/A	N/A	760 mmHg	10 mmHg

P3100 oil operated hydraulic deadweight testers

Operate safely and accurately at high pressures.

- 0.015 % accuracy standard, 0.008 % optional
- Built-in Priming Pump allows for quick purging and initial generation of pressure
- High quality screw press for pressure generation and fine control
- Clear reservoir allows for easy visual inspection of fluid cleanliness



Each unit includes

- Weight Set trimmed to the supplied local gravity
- Detachable lid
- Accredited Calibration Certificate
- Adaptors for 1/8, 1/4, 3/8, 1/2 NPT and BSP and metric adaptors (M20 and M14)
- Operating fluid
- Spare seals

Maximize your capability by covering the widest possible pressure range

Unit	Model	Internal pump	Pressure range				Vacuum range	
			Minimum	Maximum	Standard Increment	Optional Increment	Maximum	Increment
SI	P3123-MPA	Dual	0.1 MPa	35 MPa	0.1 MPa	0.01 MPa	0.01 MPa	0.001 MPa
	P3124-MPA	Dual	0.1 MPa	70 MPa	0.2 MPa	0.01 MPa	0.02 MPa	0.001 MPa
	P3125-MPA	Dual	0.1 MPa	110 MPa	0.2 MPa	0.01 MPa	0.02 MPa	0.001 MPa
	P3125XT-MPA	Dual	0.1 MPa	120 MPa	0.2 MPa	0.01 MPa	0.02 MPa	0.001 MPa
bar	P3123-BAR	Dual	1 bar	350 bar	1 bar	0.1 bar	0.1 bar	0.01 bar
	P3124-BAR	Dual	1 bar	700 bar	2 bar	0.1 bar	0.2 bar	0.01 bar
	P3125-BAR	Dual	1 bar	1,100 bar	2 bar	0.1 bar	0.2 bar	0.01 bar
	P3125XT-BAR	Dual	1 bar	1,200 bar	2 bar	0.1 bar	0.2 bar	0.01 bar
psi	P3123-PSI	Dual	10 psi	5000 psi	10 psi	1 psi	1 psi	0.1 psi
	P3124-PSI	Dual	10 psi	10,000 psi	20 psi	1 psi	2 psi	0.1 psi
	P3125-PSI	Dual	10 psi	16,000 psi	20 psi	1 psi	2 psi	0.1 psi
kgf/cm ²	P3123-KGCM2	Dual	1 kgf/cm ²	350 kgf/cm ²	1 kgf/cm ²	0.1 kgf/cm ²	0.1 kgf/cm ²	0.01 kgf/cm ²
	P3124-KGCM2	Dual	1 kgf/cm ²	700 kgf/cm ²	2 kgf/cm ²	0.1 kgf/cm ²	0.2 kgf/cm ²	0.01 kgf/cm ²
	P3125-KGCM2	Dual	1 kgf/cm ²	1,100 kgf/cm ²	2 kgf/cm ²	0.1 kgf/cm ²	0.2 kgf/cm ²	0.01 kgf/cm ²
	P3125XT-KGCM2	Dual	1 kgf/cm ²	1,200 kgf/cm ²	2 kgf/cm ²	0.1 kgf/cm ²	0.2 kgf/cm ²	0.01 kgf/cm ²



Minimize your costs by only covering the pressure range you need

Unit	Model	Ranges	Pressure range			
			Minimum	Maximum	Standard Increment	Optional Increment
SI	P3111-KPA	Single	100 kPa	3500 kPa	10 kPa	1 kPa
	P3111-MPA	Single	0.1 MPa	3.5 MPa	0.01 MPa	0.001 MPa
	P3112-MPA	Single	0.4 MPa	14 MPa	0.01 MPa	N/A
	P3113-MPA	Single	1 MPa	35 MPa	0.1 MPa	0.01 MPa
	P3114-MPA	Single	2 MPa	70 MPa	0.2 MPa	0.02 MPa
	P3115-MPA	Single	2 MPa	110 MPa	0.2 MPa	0.02 MPa
bar	P3116-MPA	Single	2 MPa	140 MPa	0.2 MPa	0.02 MPa
	P3111-BAR	Single	1 bar	35 bar	0.1 bar	0.01 bar
	P3112-BAR	Single	4 bar	140 bar	0.1 bar	N/A
	P3113-BAR	Single	10 bar	350 bar	1 bar	0.1 bar
	P3114-BAR	Single	20 bar	700 bar	2 bar	0.2 bar
	P3115-BAR	Single	20 bar	1100 bar	2 bar	0.2 bar
psi	P3116-BAR	Single	20 bar	1400 bar	2 bar	0.2 bar
	P3111-PSI	Single	10 psi	500 psi	1 psi	0.1 psi
	P3112-PSI	Single	40 psi	2000 psi	1 psi	N/A
	P3113-PSI	Single	100 psi	5000 psi	10 psi	1 psi
	P3114-PSI	Single	200 psi	10,000 psi	20 psi	2 psi
	P3115-PSI	Single	200 psi	16,000 psi	20 psi	2 psi
kgf/cm ²	P3116-PSI	Single	200 psi	20,000 psi	20 psi	2 psi
	P3111-KGCM2	Single	1 kgf/cm ²	35 kgf/cm ²	0.1 kgf/cm ²	0.01 kgf/cm ²
	P3112-KGCM2	Single	4 kgf/cm ²	140 kgf/cm ²	0.1 kgf/cm ²	N/A
	P3113-KGCM2	Single	10 kgf/cm ²	350 kgf/cm ²	1 kgf/cm ²	0.1 kgf/cm ²
	P3114-KGCM2	Single	20 kgf/cm ²	700 kgf/cm ²	2 kgf/cm ²	0.2 kgf/cm ²
	P3115-KGCM2	Single	20 kgf/cm ²	1100 kgf/cm ²	2 kgf/cm ²	0.2 kgf/cm ²
	P3116-KGCM2	Single	20 kgf/cm ²	1400 kgf/cm ²	2 kgf/cm ²	0.2 kgf/cm ²

P3200 water operated hydraulic deadweight testers

An alternative to oil operated deadweight testers for media sensitive applications up to 10,000 psi.

- Uses distilled water as the operating fluid making it ideal for those applications where oil is not allowable
- 0.015 % accuracy standard, 0.008 % optional
- Built-in Priming Pump allows for quick purging and initial generation of pressure
- High quality screw press for pressure generation and fine control
- Clear reservoir allows for easy visual inspection of fluid cleanliness



Each unit includes

- Weight Set trimmed to the supplied local gravity
- Detachable lid
- Accredited Calibration Certificate
- Adaptors for 1/8, 1/4, 3/8, 1/2 NPT and BSP and metric adaptors (M20 and M14)
- Operating fluid
- Spare seals

Maximize your capability by covering the widest possible pressure range

Unit	Model	Ranges	Pressure range					
			Minimum	Maximum	Minimum Pressure Increment - High Range	Minimum Pressure Increment - Low Range	Optional Fine Increment - High Range	Optional Fine Increment - Low Range
SI	P3223-MPA	Dual	0.1 MPa	35 MPa	0.1 MPa	0.01 MPa	0.01 MPa	0.001 MPa
	P3224-MPA	Dual	0.1 MPa	70 MPa	0.2 MPa	0.01 MPa	0.02 MPa	0.001 MPa
bar	P3223-BAR	Dual	1 bar	350 bar	1 bar	0.1 bar	0.1 bar	0.01 bar
	P3224-BAR	Dual	1 bar	700 bar	2 bar	0.1 bar	0.2 bar	0.01 bar
psi	P3223-PSI	Dual	10 psi	5000 psi	10 psi	1 psi	1 psi	0.1 psi
	P3224-PSI	Dual	10 psi	10,000 psi	20 psi	1 psi	2 psi	0.1 psi
kgf/cm ²	P3223-KGCM2	Dual	1 kgf/cm ²	350 kgf/cm ²	1 kgf/cm ²	0.1 kgf/cm ²	0.1 kgf/cm ²	0.01 kgf/cm ²
	P3224-KGCM2	Dual	1 kgf/cm ²	700 kgf/cm ²	2 kgf/cm ²	0.1 kgf/cm ²	0.2 kgf/cm ²	0.01 kgf/cm ²



Minimize your costs by only covering the pressure range you need

Unit	Model	Ranges	Pressure range					
			Minimum	Maximum	Minimum Pressure Increment - High Range	Minimum Pressure Increment - Low Range	Optional Fine Increment - High Range	Optional Fine Increment - Low Range
SI	P3211-KPA	Single	100 kPa	3500 kPa	10 kPa	N/A	1 kPa	N/A
	P3211-MPA	Single	0.1 MPa	3.5 MPa	0.01 MPa	N/A	0.001 MPa	N/A
	P3212-MPA	Single	0.4 MPa	14 MPa	0.01 MPa	N/A	N/A	N/A
	P3213-MPA	Single	1 MPa	35 MPa	0.1 MPa	N/A	0.01 MPa	N/A
	P3214-MPA	Single	2 MPa	70 MPa	0.2 MPa	N/A	0.02 MPa	N/A
bar	P3211-BAR	Single	1 bar	35 bar	0.1 bar	N/A	0.01 bar	N/A
	P3212-BAR	Single	4 bar	140 bar	0.1 bar	N/A	N/A	N/A
	P3213-BAR	Single	10 bar	350 bar	1 bar	N/A	0.1 bar	N/A
	P3214-BAR	Single	20 bar	700 bar	2 bar	N/A	0.2 bar	N/A
psi	P3211-PSI	Single	10 psi	500 psi	1 psi	N/A	0.1 psi	N/A
	P3212-PSI	Single	40 psi	2000 psi	1 psi	N/A	N/A	N/A
	P3213-PSI	Single	100 psi	5000 psi	10 psi	N/A	1 psi	N/A
	P3214-PSI	Single	200 psi	10,000 psi	20 psi	N/A	2 psi	N/A
kgf/cm ²	P3211-KGCM2	Single	1 kgf/cm ²	35 kgf/cm ²	0.1 kgf/cm ²	N/A	0.01 kgf/cm ²	N/A
	P3212-KGCM2	Single	4 kgf/cm ²	140 kgf/cm ²	0.1 kgf/cm ²	N/A	N/A	N/A
	P3213-KGCM2	Single	10 kgf/cm ²	350 kgf/cm ²	1 kgf/cm ²	N/A	0.1 kgf/cm ²	N/A
	P3214-KGCM2	Single	20 kgf/cm ²	700 kgf/cm ²	2 kgf/cm ²	N/A	0.2 kgf/cm ²	N/A

P3800 high-pressure oil operated hydraulic deadweight testers

- Standard accuracy of 0.02% Reading, 0.015% Reading available
- Includes built-in hand pump and intensifier for generating high pressures
- Tungsten carbide piston and cylinder provides long-term stability and durability



Each unit includes

- Weight Set trimmed to the supplied local gravity
- Accredited Calibration Certificate
- Operating Fluid
- High Pressure Adaptors

Unit	Model	Ranges	Pressure range			
			Minimum	Maximum	Standard Increment	Optional Increment
SI	P3830-MPA	Single	4 MPa	200 MPa	0.2 MPa	0.02 MPa
	P3840-MPA	Single	4 MPa	260 MPa	0.2 MPa	0.02 MPa
	P3860-MPA	Single	4 MPa	400 MPa	0.2 MPa	0.02 MPa
bar	P3830-BAR	Single	40 bar	2,000 bar	2 bar	0.2 bar
	P3840-BAR	Single	40 bar	2,600 bar	2 bar	0.2 bar
	P3860-BAR	Single	40 bar	4,000 bar	2 bar	0.2 bar
psi	P3830-PSI	Single	500 psi	30,000 psi	20 psi	2 psi
	P3840-PSI	Single	500 psi	40,000 psi	20 psi	2 psi
	P3860-PSI	Single	500 psi	60,000 psi	20 psi	2 psi

Fluke Calibration. *Precision, performance, confidence.™*

Electrical	RF	Temperature	Pressure	Flow	Software
------------	----	-------------	----------	------	----------

Fluke Calibration
PO Box 9090, Everett, WA 98206 U.S.A.

Fluke Europe B.V.
PO Box 1186, 5602 BD
Eindhoven, The Netherlands

For more information call:
In the U.S.A. (877) 355-3225 or
Fax (425) 446-5116
In Europe/M-East/Africa +31 (0) 40
2675 200 or Fax +31 (0) 40 2675 222
In Canada (800)-36-FLUKE or
Fax (905) 890-6866

From other countries +1 (425) 446-5500 or
Fax +1 (425) 446-5116
Web access: <http://www.flukecal.com>

©2014-2015 Fluke Calibration.
Specifications subject to change without notice.
Printed in U.S.A. 6/2015 6003026b-en
Pub-ID 13222-eng

**Modification of this document is not permitted
without written permission from Fluke Calibration.**